



Flat batteries may erase your MARPOL data

Port State inspectors compare the Bilge Alarm data to the entries in the Oil Record Book and if that data is unavailable, inspectors may find the vessel deficient. We share a lesson learned to avoid deficiencies and consequent delay.

Published 06 August 2019

The information provided in this article is intended for general information only. While every effort has been made to ensure the accuracy of the information at the time of publication, no warranty or representation is made regarding its completeness or timeliness. The content in this article does not constitute professional advice, and any reliance on such information is strictly at your own risk. Gard AS, including its affiliated companies, agents and employees, shall not be held liable for any loss, expense, or damage of any kind whatsoever arising from reliance on the information provided, irrespective of whether it is sourced from Gard AS, its shareholders, correspondents, or other contributors.

[According to IMO guidelines](#) , the 15 ppm Bilge Alarm should record date, time and alarm status, and operating status of the 15 ppm Bilge Separator. The recording device should also store data for at least eighteen months and should be able to display or print a protocol for official inspections as required. In the event the 15 ppm Bilge Alarm is replaced, means should be provided to ensure the data recorded remains available on board for 18 months.

During recent Port State inspections, US Coast Guard inspectors found MARPOL deficiencies related to the 15-ppm bilge alarm system of four ships. They discovered that the entries in the vessels' Oil Record Books did not correspond to the data being displayed by the 15-ppm bilge alarm/oil content meter.

In each case the US Coast Guard issued a Port State deficiency and required each of the deficiencies found to be rectified to the satisfaction of Recognized Organization, Flag Administration, and the US Coast Guard prior to the vessels' departure from port.

Further investigation found that the specific bilge alarm monitors in these cases were of an older type. The battery was designed to last the lifetime of the device and was located inside and behind the circuit board of the 15-ppm bilge alarm system. The manufacturer's manual indicated that during a main power supply failure combined with a low back-up battery voltage, the unit would lock down and display an error message.

In all four cases, the battery voltage was extremely low and failed to provide the required 2.5 volts necessary to maintain the stored data without error. As a result, when the data was viewed on the LCD screen it was scrambled and inaccurate.

Newer models are equipped with the possibility to replace the back-up battery because they use a capacitor that ensures enough energy to maintain the stored data for several hours.

Warning and recommendations

In a [Safety Alert of 31 July 2019](#) the US Coast Guard has issued lessons learned and strong recommendations that ship owners and operators routinely review the stored data available through the 15-ppm bilge alarm system to ensure that the data matches the information recorded in the ORB and actual OWS operations. In the event the equipment is replaced, means should be provided to ensure the data recorded remains available on board for 18 months.

In order to avoid potential Port State penalties or departure delays, Gard's Members and clients should remember that Port State Control Officers performing MARPOL examinations will verify that the 15-ppm bilge alarm system is recording data properly and is aligned with the ORB entries.

The information provided in this article is intended for general information only. While every effort has been made to ensure the accuracy of the information at the time of publication, no warranty or representation is made regarding its completeness or timeliness. The content in this article does not constitute professional advice, and any reliance on such information is strictly at your own risk. Gard AS, including its affiliated companies, agents and employees, shall not be held liable for any loss, expense, or damage of any kind whatsoever arising from reliance on the information provided, irrespective of whether it is sourced from Gard AS, its shareholders, correspondents, or other contributors.