

## Engine room fires are still a major concern

Gard has seen five fires originating in the main and auxiliary engines in the first month of 2025 alone. Tragically, some of these fires resulted in fatalities and serious injuries to seafarers. While it is too early to draw any conclusions about the rest of the year, it may be helpful to review our experiences from recent years. Although the main cause of these fires may not be identical, there are certain similarities in the underlying patterns of the fires.

Published 13 February 2025

Written by Siddharth Mahajan, Kim Watle, Svend Leo Larsen

*The information provided in this article is intended for general information only. While every effort has been made to ensure the accuracy of the information at the time of publication, no warranty or representation is made regarding its completeness or timeliness. The content in this article does not constitute professional advice, and any reliance on such information is strictly at your own risk. Gard AS, including its affiliated companies, agents and employees, shall not be held liable for any loss, expense, or damage of any kind whatsoever arising from reliance on the information provided, irrespective of whether it is sourced from Gard AS, its shareholders, correspondents, or other contributors.*


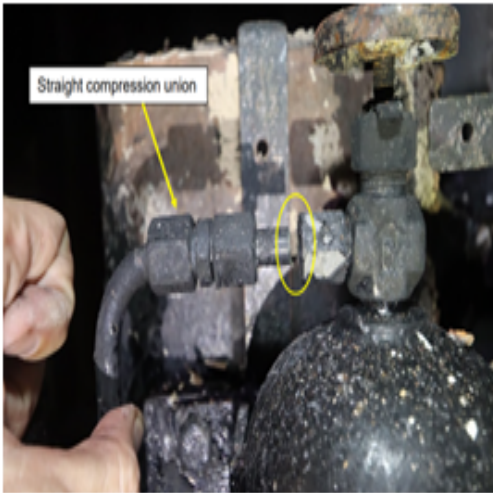
# Introduction

Every year fires on board ships lead to loss of lives and severe damage to the ships themselves. Most fires on board ships originate in the engine room where the three ingredients for a fire, namely fuel, oxygen and a source of ignition, exist in abundance. These do not only start the fire but also feed and intensify it further. Fire safety is not only about detecting and fighting a fire, but also about preventing it from igniting in the first place.

In this article we will focus on how these fires can be prevented. We will touch upon some of the main causes of engine room fires and explore insights from our claims data to understand the frequency of such fires before setting out some recommendations on how to mitigate the risks of these fires occurring.

## How do most engine room fires start?

A review of Gard’s hull and machinery (H&M) claims for the years 2017-2024 related to fires and explosions on vessels, shows that nearly 60% of all such fires originated in the engine room. Nearly two thirds of these engine room fires occurred on the main and auxiliary engines or their associated components such as turbochargers. The majority of these incidents were caused by a failure in a flammable oil system, most often in the low-pressure fuel oil piping, allowing spray of oil onto an unprotected hot surface. Below is an example from our claims portfolio.

Case study	
A copper pipe that was part of the fuel oil pressure gauge supply pipework for one of the auxiliary engines fractured due to a missing metal spray shield. The fuel oil sprayed onto this unprotected hot surface of the turbocharger and the previous system which had a temperature of more than 400°C. The fuel ignited on the engine block.	
	
Fire damaged area of auxiliary engine	Fractured copper pipe

The information provided in this article is intended for general information only. While every effort has been made to ensure the accuracy of the information at the time of publication, no warranty or representation is made regarding its completeness or timeliness. The content in this article does not constitute professional advice, and any reliance on such information is strictly at your own risk. Gard AS, including its affiliated companies, agents and employees, shall not be held liable for any loss, expense, or damage of any kind whatsoever arising from reliance on the information provided, irrespective of whether it is sourced from Gard AS, its shareholders, correspondents, or other contributors.

*In the above case, there are two main aspects which need to be highlighted.*

- *First*

is the leakage of flammable oil; and

- *Second*

is the inadequate protection to prevent highly flammable fuel from coming in contact with a source of ignition.

## Leakage or spray of fuel due to a failure in the oil system

Below we list some of the most commonly occurring causes of fuel spraying from low pressure piping systems. The list is by no means exhaustive, but a review of past Gard cases has shown that below listed failures occur frequently.

- Piping, piping connections and other associated components, such as o-rings, were not original parts or of a type recommended by the manufacturer. In some cases, modifications had been done by the crew under existing management, whilst in others the crew were not aware of such modifications as they had been done under previous ownership or management.
- Piping connection had not been tightened to the required torque and with time it loosened due to, for example, vibrations. Another reason may be incorrect assembly after maintenance.
- Bolts for flanges or filters breaking due to fatigue caused by overtightening over a period of time. In some cases, securing bolts were also found loose or missing altogether.
- Fatigue fracture of pipes. Such pipes are typically not well supported along their entire length, which causes excessive stress due to vibrations. Lack of support may be attributed to the design or failure to reinstall the holding brackets after maintenance.
- Fuel oil filter covers coming loose and displacement of the spindle from the top cover for various reasons.
- Rupture of rubberized hoses due to degradation caused by the heat generated from nearby machinery, or use of non-original spare part.
- Engine manufacturers' design improvement recommendations not implemented

## Oil coming in contact with hot surfaces

*The information provided in this article is intended for general information only. While every effort has been made to ensure the accuracy of the information at the time of publication, no warranty or representation is made regarding its completeness or timeliness. The content in this article does not constitute professional advice, and any reliance on such information is strictly at your own risk. Gard AS, including its affiliated companies, agents and employees, shall not be held liable for any loss, expense, or damage of any kind whatsoever arising from reliance on the information provided, irrespective of whether it is sourced from Gard AS, its shareholders, correspondents, or other contributors.*

- Shielding can either be by insulating hot spots with thermal insulation or anti-splashing tapes, and/or by using physical barriers such as spray shields.

- The potential risks associated with the proximity of fuel oil/lubricating oil piping installations to hot surfaces may not be comprehensively addressed during the newbuild stage by the shipyard or the vessel's classification society.

Some typical issues with insulation which we have seen in our claims portfolio are:

- the quality may differ from yard to yard, it can deteriorate with age,
- it may not have been fixed back properly after maintenance, and
- it can become soaked with oil over a period of time due to minor leakages.

As for physical barriers:

- they may not have been part of the original design and therefore not fitted, or
- where fitted, they may not have been installed back in place after maintenance has been carried out on the oil system, as in our case study, and as time passes may even be misplaced.

Older vessels need more attention

One of the factors which must be considered when assessing fire risks in engine rooms is the age of vessels. The risk of leakages from machinery may increase as ships grow older. We discuss this further below but highlight here some of the main issues that can increase the risk of fire in the engine room on older vessels.

- Protection of hot surfaces may degrade, thereby increasing the probability of ignition and risk of fires.
- Older vessels can face cuts to their maintenance and safety budgets as they near the end of their service life.
- A vessel may have changed ownership and management a number of times during its life, and this can have a direct impact on the consistency of maintenance in the engine room.
- Older vessels may lack the advanced fire detection and suppression systems found on newer ships.

*The information provided in this article is intended for general information only. While every effort has been made to ensure the accuracy of the information at the time of publication, no warranty or representation is made regarding its completeness or timeliness. The content in this article does not constitute professional advice, and any reliance on such information is strictly at your own risk. Gard AS, including its affiliated companies, agents and employees, shall not be held liable for any loss, expense, or damage of any kind whatsoever arising from reliance on the information provided, irrespective of whether it is sourced from Gard AS, its shareholders, correspondents, or other contributors.*

- Sourcing spare parts for older machinery can be difficult and expensive, potentially leading to delays in repairs and the use of less reliable temporary fixes

### Typical hotspots in the engine room

Based on previous fire incidents handled by Gard, we have found that the below listed areas acted as a source of ignition in most cases. The temperature of these areas can easily exceed 500 °C which may be well above the oil's auto ignition temperature.


- Exhaust manifold, pipes and associated flanges
- Exposed areas of boilers
- Turbochargers
- Indicator valves on cylinders
- Heater for purifier units
- Electrical wires/components and switchboards. Melting or smoldering of cables can also contribute to the transmission of heat

## Data insights – do the numbers tell their own story?

In Gard, when analyzing trends, we, just like [Cefor](#) (The Nordic Association of Marine Insurers), follow closely the frequency trends of incidents over a given time period. This way we are also able to account for the growth in our portfolio from one year to the next. From 2017 to 2024, main engine fire frequency has shown a slight downward trend, while auxiliary engine fires have remained steady.

*The information provided in this article is intended for general information only. While every effort has been made to ensure the accuracy of the information at the time of publication, no warranty or representation is made regarding its completeness or timeliness. The content in this article does not constitute professional advice, and any reliance on such information is strictly at your own risk. Gard AS, including its affiliated companies, agents and employees, shall not be held liable for any loss, expense, or damage of any kind whatsoever arising from reliance on the information provided, irrespective of whether it is sourced from Gard AS, its shareholders, correspondents, or other contributors.*



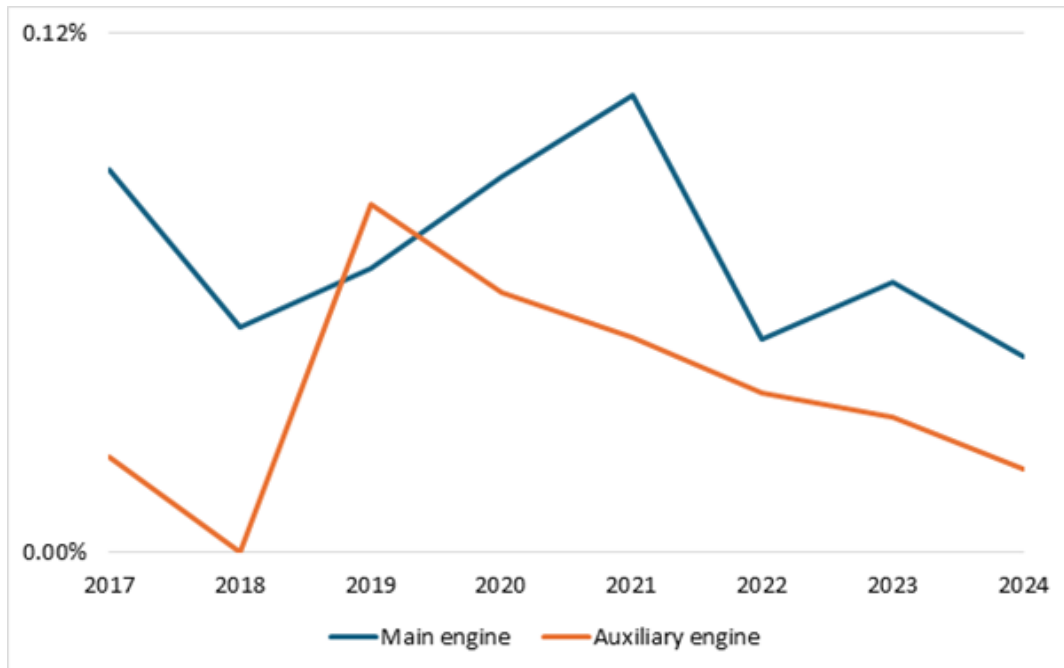

### *Frequency of engine fires (GARD H&M data)*

Between 2017 and 2024, main engine fires occurred on an average of 0.07% of vessels annually. This translates to approximately 7 fires per 10,000 vessels each year. While this percentage may seem low, the consequences of such fires are severe, impacting human life, the environment, and causing substantial financial losses. Auxiliary engine fires were slightly less frequent at 0.04%.


**Vessel Segment:** Do specific vessel types present a greater risk of machinery fires?

Passenger ships experience the highest combined frequency of main and auxiliary engine fires, and among cargo vessels, car carriers and container vessels experience a higher frequency of such fires, possibly due to a higher number of auxiliary engines on all these ships compared to other vessel types. Bulk carriers, on the other hand, generally demonstrate better performance in this area. When examining the various size segments within cargo ships, the mid-size vehicle carrier segment (10k – 20k dwt) and Container Intermediate 2 segment (6,000-8,000 teu) had the highest main engine fire frequency. Whereas, for auxiliary engine fires, it is the container feeder segment (<3,000 teu).

### **Age as a factor**

As previously discussed, vessel age is a significant factor in fire risk assessment. Our data reveals a higher incidence of engine room fires in older vessels, as shown in the graph below.

*The information provided in this article is intended for general information only. While every effort has been made to ensure the accuracy of the information at the time of publication, no warranty or representation is made regarding its completeness or timeliness. The content in this article does not constitute professional advice, and any reliance on such information is strictly at your own risk. Gard AS, including its affiliated companies, agents and employees, shall not be held liable for any loss, expense, or damage of any kind whatsoever arising from reliance on the information provided, irrespective of whether it is sourced from Gard AS, its shareholders, correspondents, or other contributors.*

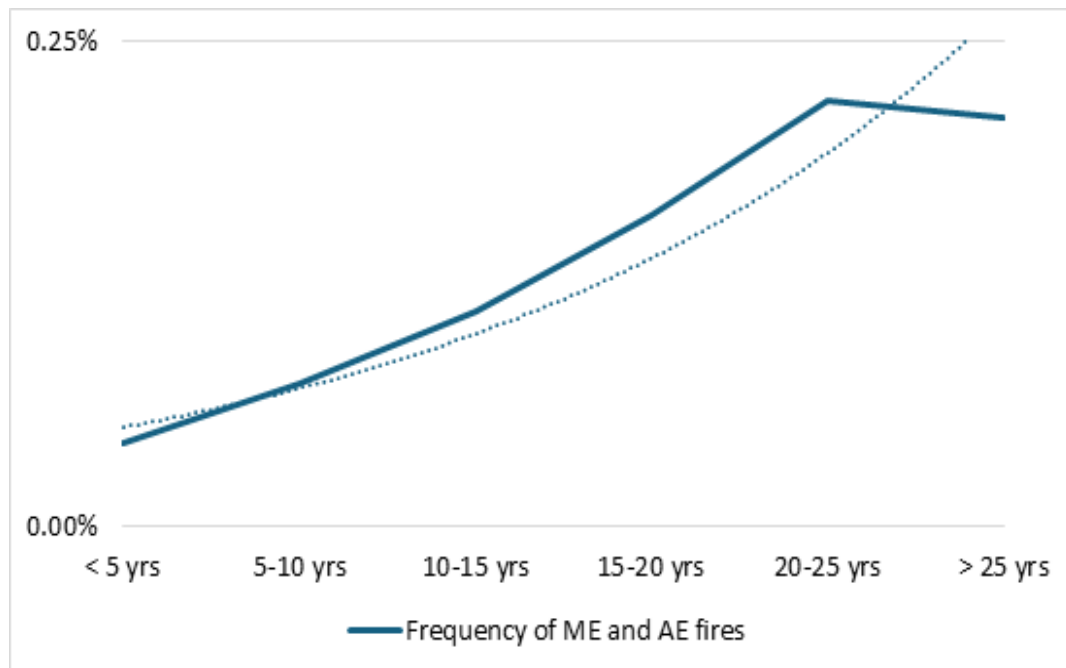


### *Frequency of engine fires by age of vessels (GARD H&M data)*

Interestingly, concentrated inspection campaigns (CIC) by Port State Control MoUs on 'Fire Safety' carried out in 2023 concluded that the rate of detention for vessels failing certain CIC items seemed to increase as ships get older. See the [Paris MoU report](#) and [Tokyo MoU report](#).

### Poor port state inspection performance linked to increased fire risk

Ships accumulating more deficiencies per inspection over the three years preceding an incident face a heightened risk of fire in their main or auxiliary engine. This risk increases with the number of deficiencies. Numerous deficiencies might be indicative of a broader problem with maintenance on board and safety culture within the organization. It's important to note that beyond seven deficiencies per inspection, the available data becomes too limited.

*The information provided in this article is intended for general information only. While every effort has been made to ensure the accuracy of the information at the time of publication, no warranty or representation is made regarding its completeness or timeliness. The content in this article does not constitute professional advice, and any reliance on such information is strictly at your own risk. Gard AS, including its affiliated companies, agents and employees, shall not be held liable for any loss, expense, or damage of any kind whatsoever arising from reliance on the information provided, irrespective of whether it is sourced from Gard AS, its shareholders, correspondents, or other contributors.*

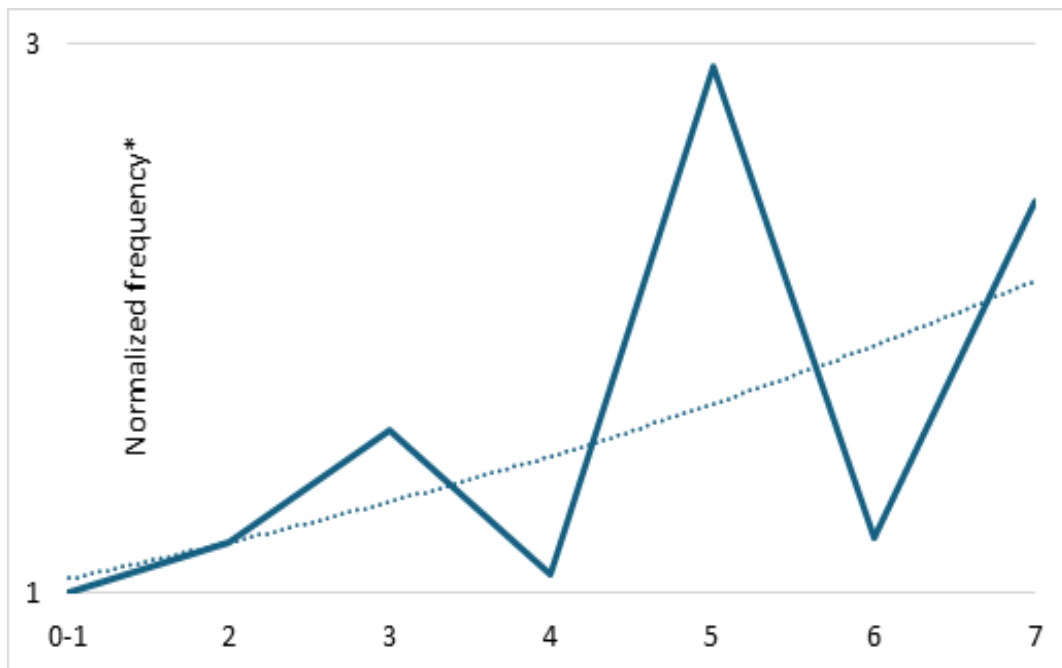

*Number of deficiencies per PSC inspection*

*\*Note: Normalized frequency shows the relative risk of an engine fire for vessels with different numbers of deficiencies per inspection, using vessels with '0-1 deficiencies per inspection' as the baseline. For example, vessels with 5 deficiencies per inspection have nearly 3 times the risk.*

## Recommendations

Failure in an oil system followed by deposit of oil onto a high temperature surface is the leading cause of engine room fires. We have the following three key recommendations which can help owners, managers and their crew reduce the risk of such fires occurring.

### 1. Identifying sources of leakages


Checking fuel and lube oil pipes for loose fittings, missing bolts on flanges, non-metallic hoses in areas where the temperatures can exceed the oil's ignition point etc., from where oil can spray onto hot surfaces should be part of the vessel's planned maintenance system. It is recommended that the assessment to identify potential sources of leakages be done on a regular basis. Also look out for whether the components of the oil piping system are original and meet the manufacturer's specifications. This is particularly important when taking over a secondhand ship either under management or ownership.

### 2. Mapping hot surfaces using thermography


*The information provided in this article is intended for general information only. While every effort has been made to ensure the accuracy of the information at the time of publication, no warranty or representation is made regarding its completeness or timeliness. The content in this article does not constitute professional advice, and any reliance on such information is strictly at your own risk. Gard AS, including its affiliated companies, agents and employees, shall not be held liable for any loss, expense, or damage of any kind whatsoever arising from reliance on the information provided, irrespective of whether it is sourced from Gard AS, its shareholders, correspondents, or other contributors.*



Owners/managers should incorporate the use of thermography onboard for detection of hot surfaces and for checking insulation during normal operations. Owners should consider including thermographic examinations in new building specifications and have such tests carried out during sea trials. A thermographic examination of the engine room and the vessel's electrical installation should be carried out periodically with engines and electrical equipment running. It is important to note that spot thermometers have limited effectiveness, as they only measure the temperature at a single point.

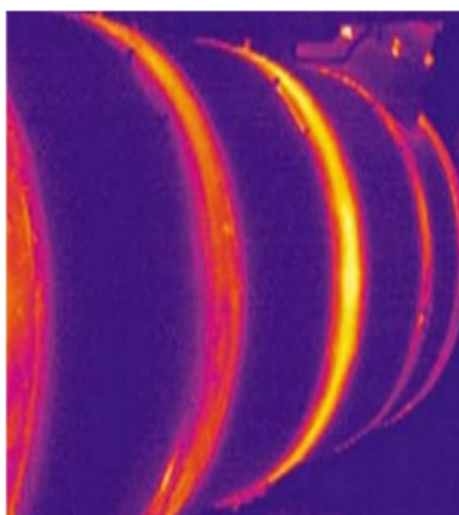

Thermo of the exhaust manifold of the main engine shows a max. temperature of 250°C.

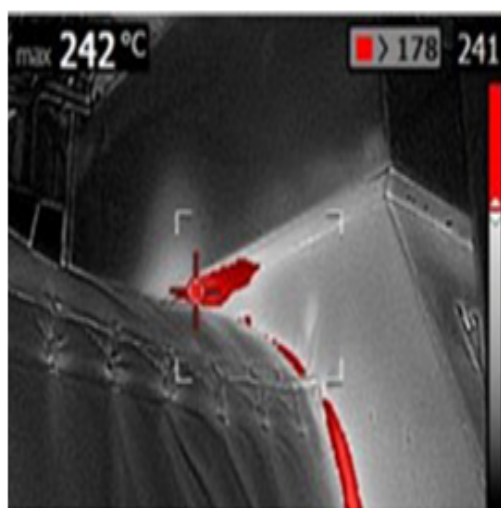

Exhaust manifold showing a max. tempetuare of 242°C.

The UK Marine Accident Investigation Branch (MAIB) has recommended that the UK Maritime & Coastguard Agency (MCA) submit a proposal to the International Maritime Organization (IMO) requiring the use of thermographic equipment to identify exposed high-temperature surfaces. Additionally, classification societies offer voluntary notations for fire protection in machinery spaces that require the use of thermal cameras for hotspot detection. This raises the question within the industry of whether current statutory regulations and Class rules adequately address the regular identification of machinery space hotspots.

### 3. Shielding hotspots

**Insulation:** As materials used to insulate high temperature surfaces may degrade over time or become oil-soaked, regular checks should be carried out. Even if the insulation of an exhaust pipe / system appears to be in good order, there may be hidden inadequately insulated areas and smaller open hot spots which could start a fire if in contact with oil.

**Spray shields :** The position and condition of spray shields for both high- and low-pressure flammable oil lines should be checked regularly, as should the drainage arrangements for jacketed fuel oil pipes. Where spray shields are not included in the original design and the area has been identified as a potential source of oil leakage, then the installation of spray shields should be considered. Particular attention

The information provided in this article is intended for general information only. While every effort has been made to ensure the accuracy of the information, the publisher, Gard AS, does not accept any liability for errors or omissions. The content in this article does not constitute professional advice, and any reliance on such information is strictly at your own risk. Gard AS, including its affiliated companies, agents and employees, shall not be held liable for any damages, including consequential damages, arising from the use of the information provided, irrespective of whether it is sourced from Gard AS, its shareholders, correspondents, or other contributors.

should also be given to the immediate and proper refitting of spray shields and insulation materials upon completion of maintenance.



Spray shield around the pressure damper on auxiliary engine



Shielding to protect the turbocharger



Guard fabricated to cover fuel system buffer (damping) tank

Referring to our initial case study above, making sure that the piping met the original specs, reinstalling the spray shield after maintenance, and using thermography to identify the exposed sections in the insulation around the turbocharger and exhaust manifold of the auxiliary engine would have prevented the fire from occurring.

The engagement of external assistance to conduct these reviews may, from time to time, be considered to provide an independent assessment of potential fire safety hazards within the engine room.

### **Additional information**

Gard

- [Fire safety onboard ships – a continuous cause for concern](#)
- Case study:  
[Engine room fire and failure of fixed fire-fighting systems](#)
- Case study:  
[Engine room fire](#)
- Case study:  
[Use of fixed carbon dioxide fire extinguishing systems](#)

*The information provided in this article is intended for general information only. While every effort has been made to ensure the accuracy of the information at the time of publication, no warranty or representation is made regarding its completeness or timeliness. The content in this article does not constitute professional advice, and any reliance on such information is strictly at your own risk. Gard AS, including its affiliated companies, agents and employees, shall not be held liable for any loss, expense, or damage of any kind whatsoever arising from reliance on the information provided, irrespective of whether it is sourced from Gard AS, its shareholders, correspondents, or other contributors.*

- Poster ([high resolution](#) and [low resolution](#)) and an [alert](#) on “Fires spread faster than you think”

- Presentation on shipboard fires: [Fire feeds on negligent deeds](#)

Class Societies, IMO and others

- [Engine room fires - causes, contributors and preventive measures](#) by DNV

- [MSC.1/Circ.1321: Guidelines for Measures to Prevent Fires in Engine Rooms and Cargo Pumps](#)

- USCG's Marine Safety Alert  
[‘Fuel Spray Fire - Déjà Vu Prepare and Prevent it from Happening to You!’](#)

- Cefor's [Fire Trend Analysis](#)

*The information provided in this article is intended for general information only. While every effort has been made to ensure the accuracy of the information at the time of publication, no warranty or representation is made regarding its completeness or timeliness. The content in this article does not constitute professional advice, and any reliance on such information is strictly at your own risk. Gard AS, including its affiliated companies, agents and employees, shall not be held liable for any loss, expense, or damage of any kind whatsoever arising from reliance on the information provided, irrespective of whether it is sourced from Gard AS, its shareholders, correspondents, or other contributors.*